

Product Update SER 15-004

Spider KnockDown Mod 710026-1 Caster Assembly June 30, 2015

PURPOSE													
				hat the connec	tio	n pin l	hole on o	lde	er version Ca	ste	r Assemblies	will not line up	
with the E	nd Fram	ne pin noie	Э.										
COMPLIANCE CATEGORY Safety Failure to comply with this product update could result in personal injury. Compliance is mandated within a specific operating time.							PRIORITY CODE 1 Prior to unit startup or prior to continued operation (Immediate Action Required)						
Compliance Required Identifies the need for action to correct a condition that, if left uncorrected, may result in reduced equipment reliability or efficiency. Compliance may be required within a specific operating time.							∑ 2 At first opportunity (Prior to Next Scheduled Maintenance Interval)						
Optional Identifies changes that may be beneficial to some, but not necessarily all. Accomplishment at customers discretion.							3 Next Scheduled Maintenance Interval						
Notification Customer communication, no action required.							Optional / Notification						
Operation Communication, no action required.									iotilication				
PRODUCT N	ODELS A	FFECTED											
SC1000/1500 SC		SC30		SC40 Zma		c Astro			ST-17 ST-19				
ST-26		ST-180		Platforms BAP				TAP		Other:			
Hoist Accessories Platform Accessories								Rigging Accessories Safety Accessories					
CONTROLLE	TCVCTEN	. ^											
COMPONENT SYSTEM Electrical			\boxtimes N	Mechanical			Safety				Other:		
Electrical				neeriamear					other.				
SUB COMPO	NENT												
	710	0026-1 Ca	ister A	Assembly with	17	5mm	shaft con	ne	ection pin hole	e w	ill not line up	,	
							ion pin h						

Product Update




SER 15-004

Spider KnockDown Mod 710026-1 Caster Assembly June 30, 2015

ACTION REQUIRED

A new version of the Caster Assembly is available that has been redesigned with a 20mm longer shaft that will allow proper hole alignment. If you have an early version of the Caster Assembly with the shaft measuring 175mm (6 7/8 in), it must be reworked the current version of 195mm (7 5/8 in). Contact Product Support to order the replacement Shaft Weldment (710672-1) to retrofit.

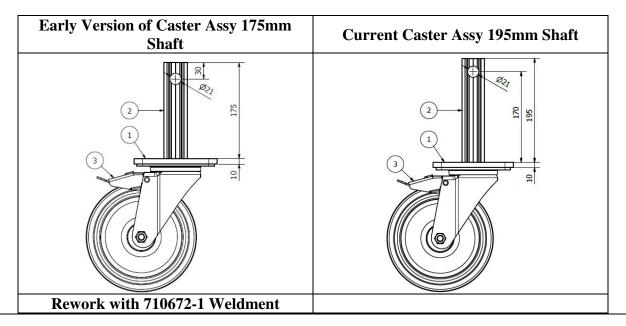

ACCOMPANYING DOCUMENTS

None