

Product Update

SER 15-003 Spider Knockdown Mod 710029-1 Quick Pin June 2, 2015

PURPOSE

It has been reported in the field that the Quick pin can fail in such a way as to become stuck in the Mod connection. The failure is the internal compression spring slips past locking lever causing the locking lever to jam in the locked position.

COMPLIANCE CATEGORY Safety Failure to comply with this product update could result in personal injury. Compliance is mandated within a specific operating time.	PRIORITY CODE 1 Prior to unit startup or prior to continued operation (Immediate Action Required)
Compliance Required Identifies the need for action to correct a condition that, if left uncorrected, may result in reduced equipment reliability or efficiency. Compliance may be required within a specific operating time.	2 At first opportunity (Prior to Next Scheduled Maintenance Interval)
Optional Identifies changes that may be beneficial to some, but not necessarily all. Accomplishment at customers discretion.	3 Next Scheduled Maintenance Interval
Notification Customer communication, no action required.	✓ 4 Optional / Notification


PRODUCT MODELS AFFECTED					
SC1000/1500 SC30	SC40	Zmac	Astro	ST-17	ST-19
ST-26 ST-180	Platforms	BAP	ТАР	Other:	
Hoist Accessories	Platform Accessori	es 🗌 Rigg	ing Accessories	Safety A	Accessories

COMPONENT SYSTEM			
Electrical	Mechanical	Safety	Other:

SUB COMPONENT

A new pin pn 702181-1 with a lanyard and clip attached is available to replace pn 710029-1 quick pin.

Spring slips off of locking lever 710029-1

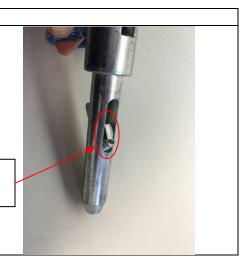

ProductSupport@SpiderStaging.com www.SpiderStaging.com



ACTION REQUIRED

If you have a PN: 710029-1Quick pin that has a failure and is covered within warranty, contact either Customer Service or Product Support for RMA to return quick pins to TOC and arrange replacement pin PN; 702181-1 Pin with Lanyard and Clip.

710029-1 Quick Pin	702181-1 Pin;Hitch 75x2.5 W/Lanyard and Clip

ProductSupport@SpiderStaging.com www.SpiderStaging.com